



Lift Track Calibration

To complete step 1, remove all weight from the transducer and click on the "Zero Calibrate" button.

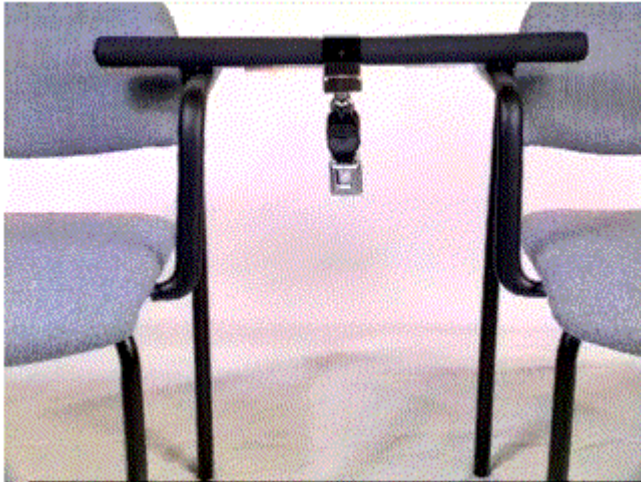

To complete step 2, enter the amount of weight to be added. Attach the weight to the transducer and click on the "Weight Calibrate" button.

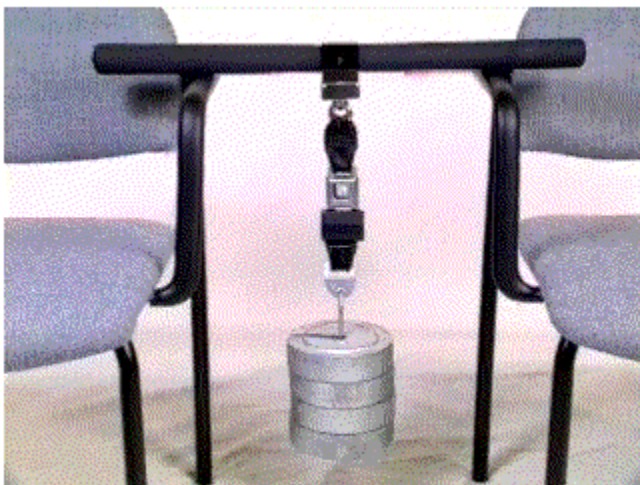

When finished, click on the "OK" button. A message indicating "Calibration Has Been Successfully Completed" will appear.

The minimum amount of weight for calibration is 25 lb., with the optimum weight being about half of the test range.